

## Residual current monitor RCMA470LY

AC / DC sensitive residual current monitor  
for TN and TT systems  
(AC, DC and pulsed DC currents)



### Device features

- External measuring current transformer
- Two separately adjustable response values, Alarm  $I_{\Delta n1}$ : 30 mA...3 A (0...150 Hz) prewarning  $I_{\Delta n2}$ : 50 % / 100 % of  $I_{\Delta n1}$
- Adjustable response delay 0...10 s (prewarning 0 / 1 s)
- Two separate alarm relays with one changeover contact each
- N/O or N/C operation
- Fault memory
- Combined TEST and RESET button
- Connection external TEST and RESET button
- LED bar graph indicator  $I_{\Delta n}$  0...100 %
- Connection external measuring instrument  $I_{\Delta n}$  0...100 %
- CT connection monitoring
- Sealable transparent cover
- Separate supply voltage
- Type B acc. to IEC 60755

### Approvals



### Product description

The AC / DC sensitive residual current monitor RCMA470LY is designed for monitoring earthed power supply systems (TN and TT systems) where DC fault currents or residual currents continuously greater than zero may occur. These are in particular loads containing six-pulse rectifiers or one way rectifiers with smoothing, such as converters, battery chargers, construction site equipment with frequency-controlled drives.

The prewarning stage (50 % of the set response value  $I_{\Delta n1}$ ) allow to distinguish between prewarning and alarm. Since the values are measured with measuring current transformers, the device is nearly independent of the load current and the nominal voltage of the system. The device can also be used for busbar systems.

### Application


- AC / DC sensitive residual current monitoring in earthed two, three or four conductor systems.
- AC / DC sensitive current monitoring of single conductors de-energized under normal conditions (e. g. N and PE conductors).
- Variable-speed drives
- Uninterruptible power supply systems (UPS)
- Construction site equipment
- Wood working machines
- Battery systems
- Computer tomographs
- Laboratory equipment
- Photovoltaic systems
- Furniture industry
- Sewage works

### Function


Residual current monitoring takes place via an external measuring current transformer. When the residual current respectively the current exceeds the set response value, the alarm LED lights and the associated alarm relay switches when the response delay has elapsed.

The alarm messages are stored. The fault memory can be reset by pressing the RESET button. The device function can be tested using the TEST button.

The currently measured value in per cent related to the set response value is shown on the LED bar graph indicator. The CT circuit is continuously monitored. In case of wire breakage, the alarm relay switches and the Power On LED flashes.

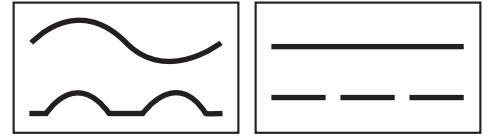


Wiring diagram – system connection, external connections

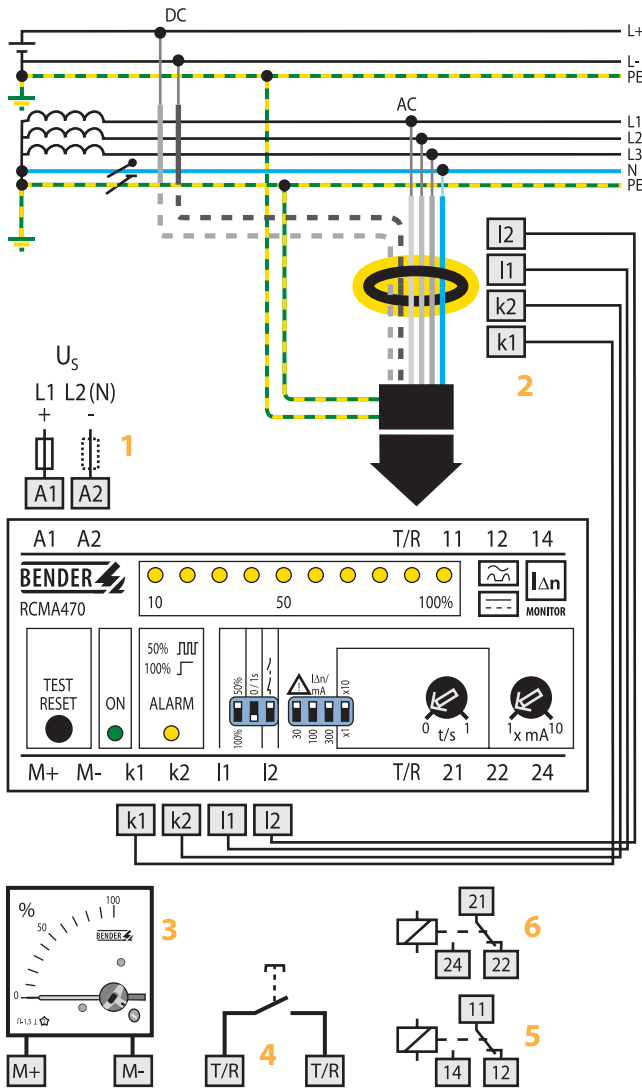

- 1 - Supply voltage  $U_S$  (see ordering information), a 6 A fuse recommended for line protection.
- 2 - External measuring current transformer W...B
- 3 - External measuring instrument
- 4 - External TEST and RESET button
- 5 - Alarm relay: switches when the fault current exceeds the response value  $I_{\Delta n1}$  (alarm) and in case of interruption of the CT connection.
- 6 - Alarm relay: switches when the fault current exceeds 50 % or 100 % of the response value  $I_{\Delta n1}$ .

**Do not route the PE conductor through the measuring current transformer!**

Wiring diagram – front plate

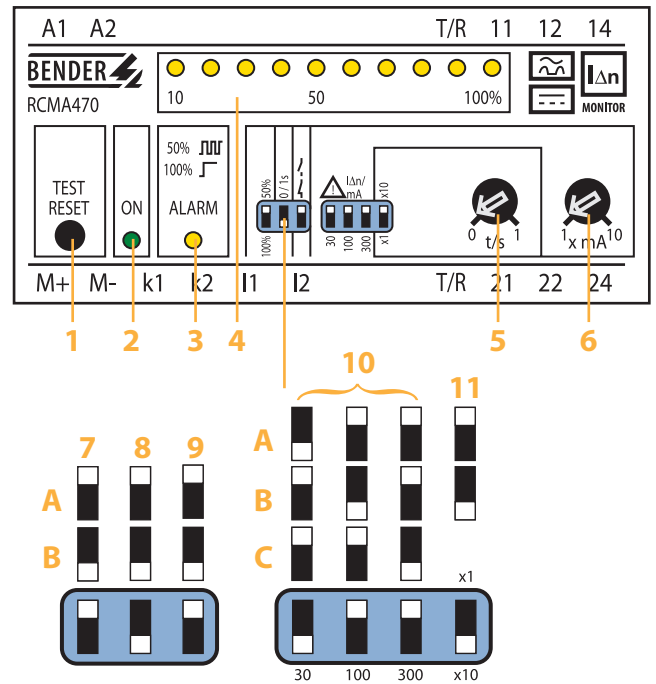

- 1 - Combined TEST and RESET button: short-time pressing ( $< 1$  s) = RESET, long-time pressing ( $> 2$  s) = TEST.
- 2 - Power On LED: lights when the device is in operation and flashes in case of interruption of the CT connection, defective CT or when the measuring range is exceeded.
- 3 - Alarm LED: lights when the fault current exceeds the set response value and flashes when 50 % of the set response value are reached.
- 4 - LED bar graph indicator, shows the measuring value in per cent related to the preset response value.
- 5 - Potentiometer for setting the response delay (0...1 s).
- 6 - Potentiometer for setting the response value ( $\times 1 \dots 10$  mA).

Setting of the DIP switches (white = switch position)

- 7 - Prewarning contact 21-22-24
  - A - Prewarning at 50 % of  $I_{\Delta n1}$
  - B - Prewarning at 100 % of  $I_{\Delta n1}$
- 8 - Response delay prewarning
  - A - Delay 1 s
  - B - Delay 0 s
- 9 - Alarm relay
  - A - N/O operation
  - B - N/C operation
- 10 - Response range
  - A - 30 mA
  - B - 100 mA
  - C - 300 mA

}  $\times 1 \dots 10$
- 11 - Response delay
  - A - Setting value  $\frac{1}{5} \times 10$
  - B - Setting value  $\frac{1}{5} \times 1$

## Technical data residual current monitor RCMA470LY

### Insulation coordination acc. to IEC 60664-1

Rated insulation voltage	AC 250 V
Rated impulse voltage / pollution degree	4 kV / 3

### Voltage ranges

Supply voltage $U_s$	see ordering information
Operating range of $U_s$	0.85...1.1 x $U_s$
Frequency range of $U_s$	DC / 50...60 Hz
Power consumption	≤ 3.5 VA

### Measuring circuit / response values

External measuring current transformer	W...B series
Operating characteristic acc. to IEC 60755	Type B
Rated residual operating current $I_{\Delta n2}$ (prewarning)	50 / 100 % of $I_{\Delta n1}$
Response delay $t_v$	0 / 1 s
Rated residual operating current $I_{\Delta n1}$ (alarm)	30 mA...3 A
Response delay $t_v$ , adjustable	0...10 s
Rated frequency	0...150 Hz
Relative percentage error	0...-25 %
Hysteresis	approx. 25 % of the response value
Response time $t_{an}$ at $I_{\Delta n1} = 1 \times I_{\Delta n1/2}$ ( $t_v = 0$ s)	< 70 ms
Response time $t_{an}$ at $I_{\Delta n1} = 5 \times I_{\Delta n1/2}$ ( $t_v = 0$ s)	< 40 ms

### Displays

LED bar graph indicator	0...100 %
LEDs	Power On, prewarning, alarm

### Inputs / outputs

TEST and RESET button	internal / external
Cable length external TEST and RESET button	≤ 10 m
Current source for external measuring instrument 0...100 %	DC 0...400 $\mu$ A
Load	≤ 12.5 k $\Omega$

### Cable lengths for measuring current transformers

Single wire $\geq 0.75$ mm <sup>2</sup>	0...10 m
---	----------

### Switching elements

Number of switching elements	2 x 1 changeover contact
Operating principle, adjustable	N / C operation / N / O operation
Electrical endurance, number of cycles	12000
Rated contact voltage	AC 250 V / DC 300 V
Limited making capacity	AC / DC 5 A
Breaking capacity	2 A, AC 230 V, cos phi = 0.4 0.2 A, DC 220 V, L / R = 0.04 s
Fault memory	ON

### General data

EMC immunity	acc. to EN 61543
EMC emission	acc. to EN 61000-6-4
Shock resistance IEC 60068-2-27 (during operation)	15 g / 11 ms
Bumping IEC 60068-2-29 (during transport)	40 g / 6 ms
Vibration resistance IEC 60068-2-6 (during operation)	1 g / 10...150 Hz
Vibration resistance IEC 60068-2-6 (during transport)	2 g / 10...150 Hz
Ambient temperature, during operation	-25 °C...+70 °C
Ambient temperature, when stored	-40 °C...+75 °C
Climatic category IEC 60721-3-3	3K5
Operating mode	continuous operation
Mounting	any position
Connection	screw terminals
Connection properties	
rigid / flexible	0.2...4 / 0.2...2.5 mm <sup>2</sup>
flexible with ferrules without / with plastic collar	0.25...2.5 mm <sup>2</sup>
Conductor sizes (AWG)	24...12
Protection class, internal components (IEC 60529)	IP30
Protection class, terminals (IEC 60529)	IP20
Type of enclosure	X470
Enclosure material	polycarbonate
Screw mounting	2 x M4
DIN rail mounting acc. to	IEC 60715
Flammability class	UL94V-0
Standards	IEC 62020
Instruction leaflet	BP404001
Weight	≤ 350 g

## Ordering information

Type	Response range $I_{\Delta n}$	Rated frequency	Time delay	Measuring current transformers	Fault memory	Indication	Supply voltage $U_s$	Art. No.
RCMA470LY	30 mA...3 A	0...150 Hz	0...10 s	W35B, W60B	internal / external	×	AC 230 V	B 9404 2001 <sup>2)</sup>
RCMA470LY-13	30 mA...3 A	0...150 Hz	0...10 s	W35B, W60B	internal / external	×	AC 90...132 V*	B 9404 2003 <sup>2)</sup>
RCMA470LY-21	30 mA...3 A	0...150 Hz	0...10 s	W35B, W60B	internal / external	×	DC 9.6...84V*	B 9404 2008 <sup>1)</sup>
RCMA470LY-23	30 mA...3 A	0...150 Hz	0...10 s	W35B, W60B	internal / external	×	DC 77...286V*	B 9404 2009 <sup>1)</sup>

Other supply voltages on request

\* Absolute values of the operating range

<sup>1)</sup> For industrial application only

<sup>2)</sup> For industrial and household applications.

**Accessories**

**External measuring current transformers**

Type	Inside diameter (mm)	Art. No.
W35B	∅ 35	B 9808 0013
W60B	∅ 60	B 9808 0021






**Measuring converter**

Type	Input	Output	Art. No.
RK170	0...400 μA	0...10 V / 0/4...20 mA	B 9804 1500

**External measuring instrument**

Type	Display range	Size (mm)	Art. No.
9604-4241	0...100 %	96 x 96	B 986 807

**Conditions of operation according to IEC 62020, IEC 60755 amendment 2, Type B**

Type of current	Wave form	Tripping current
Alternating currents (50 Hz)		$0.5...1 \times I_{\Delta n}$
Pulsed DC residual currents (positive and negative half waves) half-wave current		$0.5...1.4 \times I_{\Delta n}$
Phase-controlled half-wave currents Current delay angle 90° el / 135° el		$0.5...1.4 \times I_{\Delta n}$
Half-wave current superimposed by a smooth direct current of 6 mA		$0.5...1.4 \times I_{\Delta n}$
Smooth DC residual current		$0.5...2 \times I_{\Delta n}$

**Dimension diagram X470**

Dimensions in mm

